



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		Invoice Number: 3527995	
Bus: (712)324-4088 Prv: (712)348-4308		Bus: (712)324-4088 Prv: (712)348-4308		Invoice Date: 12/20/2021	
Mob: (712)348-4308		Mob: (712)348-4308		Location: 27	
				Work Order Number: 1419655	
				Payment Type: Finance	
				Tech: TAYLOR BECKSTEAD	Page: 1 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 608C		1H00608CJB0745216	Z5708WZ	

ALL/9004/SHP/590 Retail

COMPLAINT:

**01 CORN HEAD SHOP - JOHN DEERE INSPECTION

CORRECTION:

Performed John Deere Inspection on corn head in shop

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
P3790	PARTS PROMOTIONAL DISCOUNT	-1.00	306.58	306.58	(\$306.58)	N
Labor: \$149.00						
Parts: \$0.00						
OL&M: \$0.00						
Misc: (\$306.58)						
Sub-Total: (\$157.58)						

608C/1448/E/23 Retail

COMPLAINT:

**02 ACTIVE HEIGHT CONTROL SENSOR WIRING HARNESS - Repair (Each)


REPAIR - ACTIVE HEIGHT CONTROL SENSOR WIRING HARNESS

Repair active height control sensor wiring harness.
Include description.

CORRECTION:

REPAIRED EACH ACTIVE HEIGHT CONTROL SENSOR WIRING HARNESS

Moved the bracket that it reads off of
Also cleaned connector and checked the wiring

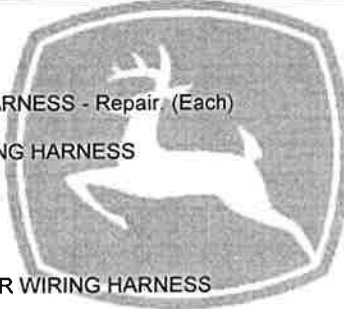

Labor: \$175.53	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$175.53
------------------------	----------------------	-------------------------	---------------------	----------------------------

608C/7058/P/10 Retail

COMPLAINT:

**03 LH DECK PLATE ADJUSTER ARM PLASTIC DEFLECTOR - Remove & Install. (Per Row)

REMOVE & INSTALL LEFT DECK PLATE ADJUSTER ARM PLASTIC DEFLECTOR

Remove & install left deck plate adjuster arm plastic deflector

CORRECTION:

R&I PER ROW LEFT DECK PLATE ADJUSTER ARM PLASTIC DEFLECTOR

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3527995**
Invoice Date: 12/20/2021
Location: 27
Work Order Number: 1419655
Payment Type: Finance

Tech: TAYLOR BECKSTEAD Page: 2 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 608C		1H00608CJB0745216	Z5708WZ	

608C/7058/P/10 Retail								
19M7865	8x16 10.9 FLANGE BULK	4.00	0.90	0.90	\$3.60			N
HXE10134	Shield	1.00	128.36	128.36	\$128.36			N
Labor: \$129.80		Parts: \$131.96		OL&M: \$0.00		Misc: \$0.00		Sub-Total: \$261.76

Gen-4 Retail
COMPLAINT:
**04 Recondition Deck Plate Sensor for Calibration

CORRECTION:
Found that the sensor was reading incorrectly and would not allow the deck plates to calibrate
Went and unplugged the sensor and checked all the wiring and cleaned connector and put back together
Moved the stop that the sensor reads off of out a little to help with the movement and make it read a little better
Calibrated and got the sensor a little closer to the voltage needed
Moved the bracket again and calibrated and got them to work fine

Labor: \$233.95	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$233.95
------------------------	----------------------	-------------------------	---------------------	----------------------------

Gen-5 Retail
COMPLAINT:
**05 Remove and Install Main Frame Bolts

CORRECTION:
Main frame bolts that were holding the row units onto the frame were wearing out
The front bolts were the worst so decided to replace them
Couldn't get a socket or a wrench to take off the bolts
Ended up getting some bolts from up front and used them to weld to the bolts to take out
Got all the bolts out and replaced with new ones and tightened and torqued down to spec



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M7846	SCREW	17.00	8.90	8.90	\$151.30	N



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3527995**
Invoice Date: 12/20/2021
Location: 27
Work Order Number: 1419655
Payment Type: Finance

Tech: TAYLOR BECKSTEAD Page: 3 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 608C		1H00608CJB0745216	Z5708WZ	

Gen-5 Retail	BULK 10.9 METRIC HARDWARE/OZ	65.00	0.50	0.50	\$32.50	N
HDW10MB						
Labor: \$295.00	Parts: \$183.80	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$478.80		

608C/6404/RWD/E/10 Retail

COMPLAINT:
**06 CHAIN ROW UNIT DRIVE EACH - Remove & Install.
REMOVE & INSTALL ROW UNIT DRIVE CHAIN EACH
Drain oil from Oil bath Cover
Remove chain cover
Loosen and remove drive chain
Reinstall and adjust drive chain
Reinstall oil bath and refill with oil



CORRECTION:
R&I ROW UNIT DRIVE CHAIN
Drain oil from Oil bath Cover
Remove chain cover
Loosen and remove drive chain
Reinstall and adjust drive chain
Reinstall oil bath and refill with oil

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH222291	Roller Chain	1.00	110.88	110.88	\$110.88	N
Labor: \$129.80	Parts: \$110.88	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$240.68		

Gen-8 Retail

COMPLAINT:
**08 Repair Broken Chopper Guard

CORRECTION:
Chopper guard on the right side of the head was cracked in a couple different spots
Removed bracket and took inside to weld cracks
Found that the rod holding the snoot right above it was cracked as well removed and welded back as well
Made sure that everything was good and secure when finished



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3527995**
Invoice Date: 12/20/2021
Location: 27
Work Order Number: 1419655
Payment Type: Finance

Tech: TAYLOR BECKSTEAD Page: 4 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 608C		1H00608CJB0745216	Z5708WZ	

Gen-8 Retail

Labor: \$73.75	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$73.75
----------------	---------------	--------------	--------------	--------------------

608C/5105/DP/10 Retail

COMPLAINT:

**09 CYLINDER DECK PLATE - Remove & Install.

REMOVE & INSTALL DECK PLATE CYLINDER

Removed cover from cylinder

Disconnected hose fittings. Close all open fittings using caps and plugs

Removed cotter pin and pin

Removed cap screw and cylinder

Installed cylinder rod into coupler and insert pin

Installed cap screw and connect hose fittings

Installed cover over cylinder



CORRECTION:

R&I deck plate cylinder

Removed cover from cylinder

Disconnected hose fittings

Close all open fittings using caps and plugs

Removed cotter pin and pin

Removed cap screw and cylinder

Installed cylinder rod into coupler and inserted pin

Installed cap screw and connected hose fittings

Installed cover over cylinder

JOHN DEERE

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AH226444	HYDRAULIC	1.00	547.34	547.34	\$547.34	N
AHC16964	HYDRAULIC	1.00	35.00	35.00	\$35.00	N
T77613	O-RING #6 FF	3.00	1.74	1.74	\$5.22	N
U46166	O-Ring	1.00	2.82	2.82	\$2.82	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3527995**
Invoice Date: 12/20/2021
Location: 27
Work Order Number: 1419655
Payment Type: Finance
Tech: TAYLOR BECKSTEAD
Page: 5 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 608C		1H00608CJB0745216	Z5708WZ	

608C/5105/DP/10 Retail P3750	SHIPPING & HANDLING	1.00	22.50	22.50	\$22.50	N
Labor: \$590.00		Parts: \$590.38	OL&M: \$0.00	Misc: \$22.50	Sub-Total: \$1,202.88	

608C/7194/RWT/R/10 Retail

COMPLAINT:

**10 SHIELD ROW UNIT TRASH PER ROW - Remove & Install.
REMOVE & INSTALL ROW UNIT TRASH SHIELD PER ROW
Remove and replace row unit trash knife shield


CORRECTION:

R&I ROW UNIT TRASH SHIELD

Remove and replace row unit trash knife shield

The back aluminum shields were wearing through and had lost most of the rubber that goes underneath as a stop as well
Got the back shields at first then customer came back a few days later and told me he wanted to put the rubber pieces on as well
with the aluminum shields

Got the shields and then got the hardware to mount the rubber pieces which is the increase in cost of the parts
Mounted everything together then got the pieces mounted to the frame and secured

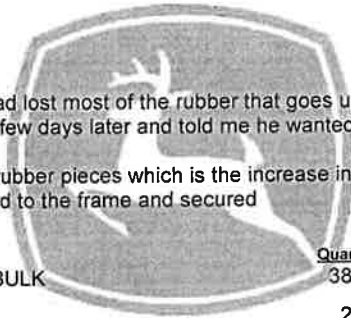

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7191	10X25 8.8 CARRAGE BULK	38.00	0.92	0.92	\$34.96	N
11M7083	Cotter Pin	2.00	0.43	0.43	\$0.86	N
14M7296	FLANGE NUT	39.00	1.30	1.30	\$50.70	N
14M7298	FLANGE NUT	20.00	0.94	0.94	\$18.80	N
19M7784	SCREW	1.00	1.27	1.27	\$1.27	N
19M7867	8X25 10.9 FLANGE BULK	12.00	0.98	0.98	\$11.76	N
HXE21073	Powershaft Shield	2.00	64.07	64.07	\$128.14	N
HXE21074	POWERSHAFT	2.00	125.56	125.56	\$251.12	N
HXE21077	Shield	2.00	71.62	71.62	\$143.24	N
HXE21079	Bracket	2.00	85.37	85.37	\$170.74	N
HXE21080	Bracket	2.00	49.90	49.90	\$99.80	N
HXE30378	POWERSHAFT	1.00	134.98	134.98	\$134.98	N



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3527995**
Invoice Date: 12/20/2021
Location: 27
Work Order Number: 1419655
Payment Type: Finance
Tech: TAYLOR BECKSTEAD Page: 6 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 608C		1H00608CJB0745216	Z5708WZ	

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
	608C/7194/RWT/R/10 Retail					
	HXE30379 Powershaft Shield	1.00	150.70	150.70	\$150.70	N
	HXE30386 Shade Curtain	2.00	96.97	96.97	\$193.94	N
	HXE30397 Bracket	2.00	95.21	95.21	\$190.42	N
	HXE89079 SHIELD	2.00	132.55	132.55	\$265.10	N
	<u>Miscellaneous</u> Description	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
P3750	SHIPPING & HANDLING	12.50	1.00	1.00	\$12.50	N
Labor: \$342.20		Parts: \$1,846.53	OL&M: \$0.00	Misc: \$12.50	Sub-Total: \$2,201.23	

608C/6936/SKC/10 Retail

COMPLAINT:
**11 KNIFE STALKMASTER CHOPPER - Remove & Install.
REMOVE & INSTALL STALKMASTER CHOPPER KNIFE
Removed lock nuts, washers, bushings, and cap screws
Removed knives from between plate
Inspected all hardware and bushings for excessive wear or damage and replace as necessary
Installed knives using cap screws, bushings, washers, and lock nuts. Tighten to specification



CORRECTION:
R&I STALKMASTER CHOPPER KNIFE
Removed lock nuts, washers, bushings, and cap screws
Removed knives from between plate
Rotated the knives to new blade side
Tightened all nuts and bolts to spec



Labor: \$225.68	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$225.68
------------------------	----------------------	-------------------------	---------------------	----------------------------

Gen-12 Retail

COMPLAINT:
**12 Change ALL Gear Case Oils

CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3527995**
Invoice Date: 12/20/2021
Location: 27
Work Order Number: 1419655
Payment Type: Finance
Tech: TAYLOR BECKSTEAD Page: 7 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 608C		1H00608CJB0745216	Z5708WZ	

Gen-12 Retail

Customer wanted all the oils changed which meant all the gear boxes
This meant both the left and right side drive chain gear boxes
All of the main drive case gear boxes where the dipstick is at
Then all the gear boxes on the main drive shafts in the rear
Also the gear boxes for the chopping blades as well
Got them all emptied and filled back up to the proper level with 80 90 oil

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26816	GL5 80W90 5 gal	1.00	167.18	167.18	\$167.18	Y
Labor: \$331.88		Parts: \$167.18		OL&M: \$0.00		Misc: \$0.00
Sub-Total: \$499.06						

Finance Information

Customer PO No:	Type: Multi-use Acct US	Auth. No: 422743
Tax Exempt No: 2018/1	Merchant No: 36000775	
Advisor: TODD FULLER	Card No: xxxxxxxxxxxx0940	
	Bill Code: 784 - COMBINE INSPECTION	
	Credit Plan: 12002 - DEERE AG NO PAYMENTS/NO INTEREST WAIVER UNTIL	

Labor:	\$2,676.59
Parts:	\$3,030.73
OL&M:	\$0.00
Misc:	(\$271.58)
Sales Tax:	\$199.07
Grand Total:	<u>\$5,634.81</u>

*** DOCUMENT COPY ***



TERMS AND CONDITIONS

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date: