



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201 Bus: 712-324-4088 Prv: (712)348-4308 Mob:(712)348-4308		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201 Bus: (712)324-4088 Prv: (712)348-4308 Mob:(712)348-4308		Invoice Number: 3014599 Invoice Date: 12/26/2019 Location: 27 Work Order Number: 1333432 Payment Type: Check Tech: ZACHARY KINNEY Page: 1 of 7	
---	--	--	--	---	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1712	1H0S660SKC0747286	Z5706WZ	

AVE/9002/PH1/590 Retail
CORRECTION:
COMPLETED COMBINE INSPECTION PHASE 1 \$299
5% OFF PART
5% OFF LABOR

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
P3790	PARTS PROMOTIONAL DISCOUNT	1.00	0.00	-110.47	(\$110.47)	N
P3794	SERVICE DISCOUNT ALLOWED	1.00	0.00	-177.19	(\$177.19)	N
Labor: \$299.00		Parts: \$0.00	OL&M: \$0.00	Misc: (\$287.66)	Sub-Total: \$11.34	

Gen-1 Retail
CORRECTION:
REPLACING MISSING PIN



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
A-HPC16	COTTER PIN	1.00	0.27	0.27	\$0.27	Y
Labor: \$67.60		Parts: \$0.27	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$67.87	

S660/6404/FHD/10 Retail
CORRECTION:
Removed & Installed feeder house drive chain
Removed shields
Separated and replaced drive chain
Replaced chain idlers as needed
Adjusted chain and reinstalled shields



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE80366	LINK CHAIN	1.00	136.93	136.93	\$136.93	N
Labor: \$84.50		Parts: \$136.93	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$221.43	

Gen-2 Retail
CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3014599**
Invoice Date: 12/26/2019
Location: 27
Work Order Number: 1333432
Payment Type: Check

Tech: ZACHARY KINNEY Page: 2 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1712	1H0S660SKC0747286	Z5706WZ	

Gen-2 Retail CLEAN AND BLOW OUT BREATHER

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH20868	BREATHER	1.00	11.13	11.13	\$11.13	N
Labor: \$71.50		Parts: \$11.13		OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$82.63

S660/1357/RVD/10 Retail CORRECTION: REMOVED & INSTALLED REVERSER DRIVE BELT

- Slowed feeder house speed to lowest speed
- Removed feeder house LH shield
- Lowered center idler
- Loosened spring carrier bolts to release pressure on sheave
- Removed belt and installed new one
- Adjusted belt to spec and reinstalled shield



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE45928	V-BELT	1.00	450.69	450.69	\$450.69	N
Labor: \$397.80		Parts: \$450.69		OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$848.49

S660/3105/GTVA/20 Retail CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201	LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201	Invoice Number: 3014599
		Invoice Date: 12/26/2019
		Location: 27
		Work Order Number: 1333432
		Payment Type: Check
Bus: 712-324-4088 Prv: (712)348-4308	Bus: (712)324-4088 Prv: (712)348-4308	Tech: ZACHARY KINNEY
Mob: (712)348-4308	Mob: (712)348-4308	Page: 3 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1712	1H0S660SKC0747286	Z5706WZ	

S660/3105/GTVA/20 Retail

Reconditioned grain tank vertical auger gear case
Disassembled gear case
Replaced all required bearings
Replaced shafts
Replaced gears
Replaced shims, etc
Reassembled in reverse order
Set up per TM manual

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
24H1533	SHIM	2.00	3.76	3.76	\$7.52	N
AH90963	SEAL	1.00	23.43	23.43	\$23.43	N
DE20711	Bevel Gear Drive	1.00	444.24	444.24	\$444.24	N
H149361	LOCK NUT	1.00	4.03	4.03	\$4.03	N
HXE16941	SHAFT	1.00	226.99	226.99	\$226.99	N
JD8524	Ball Bearing	4.00	20.13	20.13	\$80.52	N
Labor: \$429.00		Parts: \$786.73	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,215.73	



S660/1357/FED/10 Retail

CORRECTION:
Removed & Installed feed accelerator drive belt
Released tension on accelerator belt, jackshaft belt and shoe supply auger belt
Removed all belts from jackshaft
Installed new accelerator belt
Reset tension on jackshaft, accelerator and shoe auger belts
Test ran

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE95511	Feed Accelerator -TRIPPLE V-BELT	1.00	134.46	134.46	\$134.46	N
Labor: \$153.40		Parts: \$134.46	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$287.86	

S660/4164/LCG/10 Retail

CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3014599**
Invoice Date: 12/26/2019
Location: 27
Work Order Number: 1333432
Payment Type: Check
Tech: ZACHARY KINNEY
Page: 4 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1712	1H0S660SKC0747286	Z5706WZ	

S660/4164/LCG/10 Retail REMOVED & INSTALLED LOWER CLEAN GRAIN SPROCKET

- Loosened clean grain conveyor chain
- Removed connector link from clean grain conveyor chain
- Loosened both right and left hand clean grain auger lock collars and bearings and removed
- Slid auger to left allowing sprocket to be removed
- Reassembled in reverse order
- Adjusted auger and chain



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
49M4111	Shaft Key	1.00	4.45	4.45	\$4.45	N
AZ10045	ECCENTRIC	2.00	7.40	7.40	\$14.80	N
E10018	PRESSED FL	4.00	3.73	3.73	\$14.92	N
H164796	SPROCKET S	1.00	40.16	40.16	\$40.16	N
JD10384	Bearing	2.00	37.79	37.79	\$75.58	N
Labor: \$267.80		Parts: \$149.91		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$417.71

Gen-3 Retail CORRECTION: General Repairs

TOOK LINE LOOSE ON ROTOR DRIVE SHEAVE TO SLOW DOWN ROTOR MANUALLY. THEN HOOKED LINE BACK UP AND TESTED OPERATION. ROTOR WOULD SPEED UP AND SLOW DOWN AS IT SHOULD. SHEAVES WERE MORE THAN LIKELY BOUND UP AND BY REMOVING THE LINE AND RUNNING IT MANUALLY IT WAS ABLE TO RETURN TO THE CORRECT POSITION.

Labor: \$302.90	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$302.90
------------------------	----------------------	-------------------------	---------------------	----------------------------



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3014599**
Invoice Date: 12/26/2019
Location: 27
Work Order Number: 1333432
Payment Type: Check

Tech: ZACHARY KINNEY Page: 5 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1712	1H0S660SKC0747286	Z5706WZ	

S660/4164/CGEU/10 Retail

CORRECTION:

- Removed & Installed clean grain elevator upper sprocket
- Verified which direction the chain is running in the elevator for later reassembly
- Removed the clean grain elevator drive belt
- Located and removed the master link to split chain
- Lowered to ground
- Removed lock collars and bearings
- Slid shaft out and removed sprocket
- Replaced shaft and sprocket
- Installed new bearings and lock collars
- Reinstalled chain and drive belt
- Adjusted tension
- Test ran



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AZ10045	ECCENTRIC	1.00	7.40	7.40	\$7.40	N
H133143	CHAIN SPRO	1.00	46.04	46.04	\$46.04	N
H152916	PRESSED FL	2.00	5.99	5.99	\$11.98	N
JD10384	Bearing	1.00	37.79	37.79	\$37.79	N
Labor: \$612.30		Parts: \$103.21		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$715.51

Gen-4 Retail

CORRECTION:

CHECKED OIL AND SHAFTS TO MAKE SURE EVERYTHING WAS GOOD



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7589	LOCK NUT	1.00	3.01	3.01	\$3.01	N
HXE109643	Driver	1.00	64.96	64.96	\$64.96	N
Labor: \$59.80		Parts: \$67.97		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$127.77

S660/1437/A/80 Retail

CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308


Invoice Number: **3014599**
Invoice Date: 12/26/2019
Location: 27
Work Order Number: 1333432
Payment Type: Check
Tech: ZACHARY KINNEY
Page: 6 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1712	1H0S660SKC0747286	Z5706WZ	

S660/1437/A/80 Retail
Checked all controllers for latest software
Checked all electronic controllers on machine for codes and updated calibrations

Labor: \$153.40	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$153.40
-----------------	---------------	--------------	--------------	---------------------

S660/9002/PMS/41 Retail
CORRECTION:
Performed partial machine service
Changed oil in feeder house reverser gear case
Changed oil in primary counter shaft gear case
Changed fuel filters
CHANGED LIGHT BULB IN RIGHT REAR FLASHER.
TIGHTENED BELTS AND CHAINS.

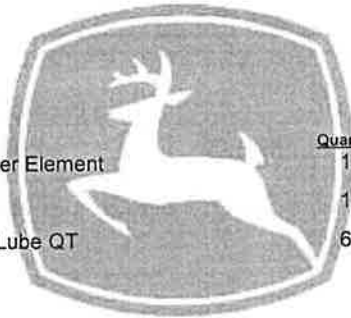

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxcd	Ind
DZ112918	2 Micron Secondary Filter Element	1.00	113.88	113.88	\$113.88	N	
RE539465	Filter Element - Primary	1.00	94.43	94.43	\$94.43	N	
TY26408	HD460 Synthetic Gear Lube QT	6.00	26.53	26.53	\$159.18	Y	





WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3014599**
Invoice Date: 12/26/2019
Location: 27
Work Order Number: 1333432
Payment Type: Check

Tech: ZACHARY KINNEY Page: 7 of 7

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1712	1H0S660SKC0747286	Z5706WZ	

S660/9002/PMS/41 Retail	1156CP	MINI BULB	1.00	0.55	0.55	\$0.55	Y
Labor: \$644.80		Parts: \$368.04	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,012.84		

Customer PO No:
Tax Exempt No: 2018/1
Advisor: TODD FULLER

*** DOCUMENT COPY ***

Labor: \$3,543.80
Parts: \$2,209.34
OL&M: \$0.00
Misc: (\$287.66)
Sales Tax: \$259.26
Grand Total: \$5,724.74



JOHN DEERE

Received by: Date:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2973500**
Invoice Date: 10/27/2019
Location: 27
Work Order Number: 1329558
Payment Type: Finance
Tech: ZACHARY KINNEY
Page: 1 of 2

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1603	1H0S660SKC0747286	Z5706WZ	

Gen-1 Retail


COMPLAINT:

01 General Repairs

CORRECTION:

CORN HEAD DECK PLATES WOULD MOVE GOING THROUGH THE FIELD. CHECKED DECK PLATE OPERATION THEY WOULD OPEN AND CLOSE AS THEY SHOULD. FOUND THE CHECK VALVES IN THE COMBINE VALVE BLOCK TO BE BAD. REPLACED THE CHECK VALVES THEN TESTED OPERATION. CUSTOMER USED IT ALL DAY IN THE FIELD AND THE DECK PLATES DID NOT MOVE.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH218992	PISTON KIT	1.00	401.38	401.38	\$401.38	N
TY26101	CLEANING S	2.00	5.39	5.39	\$10.78	Y
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
P3750	SHIPPING & HANDLING	1.00	16.39	16.39	\$16.39	N
Labor: \$202.50		Parts: \$412.16		OL&M: \$0.00	Misc: \$16.39	Sub-Total: \$631.05

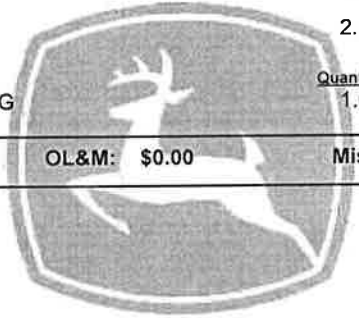

ALL/9037/22 Retail

COMPLAINT:

02 AG SERVICE CALL

CORRECTION:

AG Service Call

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
---------------	-------------	----------	------------	-----------	----------------	-----------



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2973500**
Invoice Date: 10/27/2019
Location: 27
Work Order Number: 1329558
Payment Type: Finance
Tech: ZACHARY KINNEY
Page: 2 of 2

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1603	1H0S660SKC0747286	Z5706WZ	

ALL/9037/22 Retail S3920	SERVICE CALL FEE	1.00	75.00	75.00	\$75.00	N
Labor: \$120.00		Parts: \$0.00	OL&M: \$0.00	Misc: \$75.00	Sub-Total: \$195.00	

Finance Information

Customer PO No:
Tax Exempt No: 2018/1
Advisor: KELLIE EINCK

Type: Multi-use Acct US Auth. No: 314268
Merchant No: 36000775
Card No: xxxxxxxxxxxx0940
Bill Code: 107 - SHOP WORK HARVEST EQUIP.
Credit Plan: 249 - PURCHASE

Labor: \$322.50
Parts: \$412.16
OL&M: \$0.00
Misc: \$91.39
Sales Tax: \$23.32
Grand Total: \$849.37

*** DOCUMENT COPY ***



JOHN DEERE

TERMS AND CONDITIONS

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2962117**
Invoice Date: 10/15/2019
Location: 27
Work Order Number: 1327084
Payment Type: Finance
Tech:AARON OOLMAN
Page: 1 of 2

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660		1H0S660SKC0747286	Z5706WZ	

ALL/TBD/01 Retail

CORRECTION:

AARON- DROVE TO CUSTOMER. CHECKED SENSORS. TRIED A FEW THINGS BUT DID NOT WORK. WANTED TO TRY SENSORS ON COMBINE AT THE SHOP TO VERIFY THE SENSORS WERE NOT BAD SO CUSTOMER BROUGHT THEM IN. INSTALLED ON OUR COMBINE AND THEY WORKED GOOD. ORDERED PARTS FOR CONNECTORS ON COMBINE FOR SENSOR TERMINALS.

ZACH- WENT OUT TO CUSTOMER AND REMOVED TAILINGS SENSORS. THEN REMOVED WIRING HARNESS PINS INDIVIDUALLY AND REPLACED THEM. FOUND ONE PIN THAT WAS CORRODED OFF INSIDE THE CONNECTOR.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
57M8165	ELEC. CONN	18.00	1.58	1.58	\$28.44	N
Labor: \$780.00		Parts: \$28.44		OL&M: \$0.00		Misc: \$0.00
Sub-Total: \$808.44						

ALL/9037/22 Retail

CORRECTION:

AG Service Call



JOHN DEERE



WWW.AGRIVISIONEQUIPMENT.COM

5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444



WWW.PRAIRIELANDPARTNERS.COM



SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201	LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201	Invoice Number: 2962117
Bus: 712-324-4088 Prv: (712)348-4308	Bus: (712)324-4088 Prv: (712)348-4308	Invoice Date: 10/15/2019
Mob:(712)348-4308	Mob:(712)348-4308	Location: 27
		Work Order Number: 1327084
		Payment Type: Finance
		Tech:AARON OOLMAN Page: 2 of 2

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660		1H0S660SKC0747286	Z5706WZ	

ALL/9037/22 Retail	SERVICE CALL FEE	1.00	75.00	75.00	\$75.00	N
S3920						
Labor: \$292.50	Parts: \$0.00	OL&M: \$0.00	Misc: \$75.00	Sub-Total: \$367.50		

Finance Information

Customer PO No:	Type: Multi-use Acct US	Auth. No: 694929
Tax Exempt No: 2018/1	Merchant No: 36000775	
Advisor: JEFF MARRA	Card No: xxxxxxxxxxxx0940	
	Bill Code: 100 - SHOP WORK	
	Credit Plan: 249 - PURCHASE	

Labor:	\$1,072.50
Parts:	\$28.44
OL&M:	\$0.00
Misc:	\$75.00
Sales Tax:	\$75.07
Grand Total:	\$1,251.01

*** DOCUMENT COPY ***



JOHN DEERE

TERMS AND CONDITIONS

Repayment Terms:

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date:



WWW.AGRIVISIONEQUIPMENT.COM

5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444



WWW.PRAIRIELANDPARTNERS.COM



SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		Invoice Number: 2780871	
Bus: 712-324-4088 Prv: (712)348-4308		Bus: (712)324-4088 Prv: (712)348-4308		Invoice Date: 2/13/2019	
Mob: (712)348-4308		Mob: (712)348-4308		Location: 27	
				Work Order Number: 1289157	
				Payment Type: Finance	
				Tech: TERRY DEBOER	Page: 1 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

AVE/9002/PH1/590 Retail

CORRECTION:
COMPLETED COMBINE INSPECTION PHASE 1 \$299

5% OFF PARTS AND LABOR - EARLY INSPECTION DISCOUNT

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
S3970	INSPECTION DISCOUNT	-1.00	228.28	228.28	(\$228.28)	N
P3790	PARTS PROMOTIONAL DISCOUNT	-1.00	224.64	224.64	(\$224.64)	N
Labor: \$299.00		Parts: \$0.00	OL&M: \$0.00	Misc: (\$452.92)	Sub-Total: (\$153.92)	

S660/4177/CVP/10 Retail

COMPLAINT:
05 GUIDES CONVEYOR PLASTIC - REMOVE & INSTALL

CORRECTION:
REMOVED & INSTALLED CONVEYOR PLASTIC GUIDES

Removed top doors from feeder house.
Removed 3 bolts from plastic strips.
Installed new strips with new bolts.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H171960	STRIP	3.00	20.51	20.51	\$61.53	N
Labor: \$271.43		Parts: \$61.53	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$332.96	

S660/6404/HFL/10 Retail

COMPLAINT:
06 CHAIN HALF LINK - REMOVE & INSTALL

CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2780871**
Invoice Date: 2/13/2019
Location: 27
Work Order Number: 1289157
Payment Type: Finance
Tech: TERRY DEBOER
Page: 2 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

S660/6404/HFL/10 Retail
REMOVED & INSTALLED HALF LINK FROM FEEDER HOUSE CONVEYOR CHAIN

Locked up feeder house.
Rotated chain to find half link.
Loosened chain.
Removed half link from all three chains.
Installed in reverse order.

Labor: \$136.29	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$136.29
-----------------	---------------	--------------	--------------	---------------------

S660/7558/SD/10 Retail
COMPLAINT:
07 WEAR STRIPS SERRATED - REMOVE & INSTALL



CORRECTION:
REMOVED & INSTALLED SERRATED WEAR STRIPS

Lowered feeder house all the way down and shut engine off.
Removed both feeder house top doors.
Unbolted wear strips, removed and installed.
(Torqued bolts 70 Nm or 52 lb ft).
Put together in reverse order.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H165407	PLATE	30.00	18.27	18.27	\$548.10	N
Labor: \$475.86				Parts: \$548.10	OL&M: \$0.00	Misc: \$0.00
				Sub-Total: \$1,023.96		

S660/3351/R/10 Retail
COMPLAINT:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		Invoice Number: 2780871	
Bus: 712-324-4088 Prv: (712)348-4308		Bus: (712)324-4088 Prv: (712)348-4308		Invoice Date: 2/13/2019	
Mob:(712)348-4308		Mob:(712)348-4308		Location: 27	
				Work Order Number: 1289157	
				Payment Type: Finance	
				Tech: TERRY DEBOER	Page: 3 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

S660/3351/R/10 Retail
08 BEARING ROTOR - REMOVE & INSTALL

REMOVE & INSTALL ROTOR BEARING

- Lower feeder house all the way down and shut machine off.
- Remove top two doors on feeder house.
- Remove dust suppression cover.
- Remove bearing protection bracket, grease line, tone wheel, lock collar and bearing.
- Replace parts as necessary.
- Reassemble in reverse order.
- Adjust sensor to specifications.

CORRECTION:
REMOVED & INSTALLED ROTOR BEARING



- Lowered feeder house all the way down and shut machine off.
- Removed top two doors on feeder house.
- Removed dust suppression cover.
- Removed bearing protection bracket, grease line, tone wheel, lock collar and bearing.
- Replaced parts as necessary.
- Reassembled in reverse order.
- Adjusted sensor to specifications.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE10445	WHEEL	1.00	62.00	62.00	\$62.00	N
AXE42868	BEARING WI	1.00	270.51	270.51	\$270.51	N
Labor: \$381.15		Parts: \$332.51		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$713.66

S660/6927/CE/E/10 Retail
COMPLAINT:

5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201 Bus: 712-324-4088 Prv: (712)348-4308 Mob:(712)348-4308		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201 Bus: (712)324-4088 Prv: (712)348-4308 Mob:(712)348-4308		Invoice Number: 2780871 Invoice Date: 2/13/2019 Location: 27 Work Order Number: 1289157 Payment Type: Finance Tech: TERRY DEBOER	Page: 4 of 14
--	--	---	--	--	---------------

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

S660/6927/CE/E/10 Retail
09 AUGER CLEANING SHOE EACH - REMOVE & INSTALL

REMOVE & INSTALL EACH CLEANING SHOE AUGER

Remove rear auger bearing and hanger.
Remove front auger drive gear and bearing.
Remove auger toward rear of machine.
Reassemble.

CORRECTION:
REMOVED & INSTALLED EACH CLEANING SHOE AUGER

Removed rear auger bearing and hanger.
Removed front auger drive gear and bearing.
Removed auger toward rear of machine.
Reassembled.

REPLACED FRONT AND REAR SHOE AUGER BEARINGS ON 3 SHOE AUGERS.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH163056	BEARING HO	3.00	51.39	51.39	\$154.17	N
AXE39453	BEARING	3.00	29.33	29.33	\$87.99	N
H103264	PRESSED FL	6.00	2.88	2.88	\$17.28	N
JD8554	Eccentric Locking Collar	6.00	5.69	5.69	\$34.14	N
Labor: \$450.45		Parts: \$293.58	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$744.03	

S660/6404/UAD/10 Retail
COMPLAINT:
10 CHAIN UNLOADING AUGER DRIVE - REMOVE & INSTALL

REMOVE & INSTALL UNLOADING AUGER DRIVE CHAIN

Loosen unloading auger drive chain tensioner.
Remove unloading auger drive chain.
Reinstall drive chain and adjust tensioner to proper spec.



WWW.AGRIVISIONEQUIPMENT.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2780871**
Invoice Date: 2/13/2019
Location: 27
Work Order Number: 1289157
Payment Type: Finance
Tech: TERRY DEBOER
Page: 5 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

S660/6404/UAD/10 Retail

CORRECTION:
REMOVED & INSTALLED UNLOADING AUGER DRIVE CHAIN

Loosened unloading auger drive chain tensioner.
Removed unloading auger drive chain.
Reinstalled drive chain and adjusted tensioner to proper spec.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH204389	IDLER	1.00	93.12	93.12	\$93.12	N
AXE53952	ROLLER CHAIN	1.00	216.34	216.34	\$216.34	N
Labor: \$68.15		Parts: \$309.46		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$377.61



S660/6936/CP/20 Retail

COMPLAINT:
11 KNIFE BANK CHOPPER - RECONDITION

CORRECTION:
SHARPENED STATIONARY KNIVES.

Labor: \$136.29	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$136.29
------------------------	----------------------	-------------------------	---------------------	----------------------------

S660/6953/CSR/10 Retail

COMPLAINT:
12 PITMAN ARM CLEANING SHOE RIGHT SIDE - REMOVE & INSTALL

CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2780871**
Invoice Date: 2/13/2019
Location: 27
Work Order Number: 1289157
Payment Type: Finance
Tech: TERRY DEBOER
Page: 6 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

S660/6953/CSR/10 Retail
REMOVED & INSTALLED CLEANING SHOE RIGHT AND LEFT SIDE PITMAN ARM

Loosened belt idler and removed belt from sheave.
Removed cap screws and sheave.
Removed cap screw and hub.
Removed nuts and bolts, and flanged housing.
Removed cap screws and nuts, and flanged housing.
Removed snap ring.
Removed eccentric. (Eccentric is a press fit).
Removed nuts and bolts to separate flanged housing halves.
Removed bearing.
Assembled bearing in flanged housing halves.
Installed bolts and nuts.
Assembled all in reverse order.
Ran and verified operation.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH219844	ARM	1.00	207.81	207.81	\$207.81	N
AH219846	ARM	1.00	198.99	198.99	\$198.99	N
Labor: \$271.43						
Parts: \$406.80						
OL&M: \$0.00						
Misc: \$0.00						
					Sub-Total: \$678.23	

S660/6404/TED/10 Retail
COMPLAINT:
13 CHAIN TAILING ELEVATOR RETURN AUGER DRIVE - REMOVE & INSTALL



CORRECTION:
REMOVED & INSTALLED TAILING ELEVATOR RETURN AUGER DRIVE CHAIN

Loosened chain tensioner.
Removed chain.
Installed new chain.
Tightened chain tensioner.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
34H270	SPRING PIN	1.00	0.68	0.68	\$0.68	N



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2780871**
Invoice Date: 2/13/2019
Location: 27
Work Order Number: 1289157
Payment Type: Finance

Tech: TERRY DEBOER
Page: 7 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

S660/6404/TED/10 Retail								
HDW8MB	BULK 8.8 METRIC HARDWARE/OZ	8.00	0.37	0.37	\$2.96	N		
SW50COUS	Chain Link	1.00	2.32	2.21	\$2.21	N		
SW50X50US	50 Roller Chain	56.00	0.50	0.47	\$26.32	N		
Labor: \$47.36		Parts: \$32.17		OL&M: \$0.00		Misc: \$0.00		Sub-Total: \$79.53

S660/6338/TL/11 Retail
COMPLAINT:
15 CHAIN HALF LINK TAILING ELEVATOR - REMOVE

CORRECTION:
REMOVED TAILING ELEVATOR CHAIN HALF LINK

Removed half link from chain.
Reconnected chain and adjusted to spec.
Test ran.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind	
AH137631	CHAIN LINK	1.00	6.22	6.22	\$6.22	N	
Labor: \$68.15		Parts: \$6.22		OL&M: \$0.00		Misc: \$0.00	Sub-Total: \$74.37



S660/5183/RSI/E/10 Retail
COMPLAINT:
16 PULLEY ROTARY SCREEN IDLER EACH - REMOVE & INSTALL

CORRECTION:
REMOVED & INSTALLED EACH ROTARY SCREEN IDLER PULLEY

Removed rotary screen belt from pulleys.
Removed idler pulley to be replaced.
Reassembled in reverse order.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2780871**
Invoice Date: 2/13/2019
Location: 27
Work Order Number: 1289157
Payment Type: Finance
Tech: TERRY DEBOER
Page: 8 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

S660/5183/RSI/E/10 Retail	Center Sheave	1.00	40.19	40.19	\$40.19	N
AH169549						
Labor: \$63.53	Parts: \$40.19	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$103.72		

S660/1409/E/10 Retail
COMPLAINT:
17 LIGHT BULB - REMOVE & INSTALL

CORRECTION:
REMOVED & INSTALLED EACH LIGHT BULB
Raised feeder house all the way up.
Tilted light assembly up.
Unhooked harness and turned bulb counter clock wise and removed bulb.
Installed in reverse order.

All other lights unplugged harness and removed bulbs.
Installed in reverse order.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH208904	BULB	2.00	14.00	14.00	\$28.00	N
AXE16948	BULB	1.00	12.90	12.90	\$12.90	N
Labor: \$27.72	Parts: \$40.90	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$68.62		

S660/1421/CO/10 Retail
COMPLAINT:
18 DISPLAY COMMAND - REMOVE & INSTALL

CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2780871**
Invoice Date: 2/13/2019
Location: 27
Work Order Number: 1289157
Payment Type: Finance
Tech: TERRY DEBOER
Page: 9 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

S660/1421/CO/10 Retail REMOVED & INSTALLED COMMAND DISPLAY

Removed screws from back of display and cover from armrest display unit.
Disconnected harness.
Removed display.
Installed in reverse order.
Hooked up service advisor.
Programmed display.
Verified operation.

TRANSFERRED AUTOTRAC ACTIVATION OVER TO THE NEW DISPLAY.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
SE503067	DISPLAY MO	1.00	1,400.81	1,400.81	\$1,400.81	N
SE503067-CR	CORE for:Display Module Reman	-1.00	100.00	100.00	(\$100.00)	N
Labor: \$136.29						
Parts: \$1,300.81						
OL&M: \$0.00						
Misc: \$0.00						
				Sub-Total:	\$1,437.10	

S660/1909/CL/10 Retail COMPLAINT: 19 SENSOR CHAFFER LOSS - REMOVE & INSTALL

CORRECTION:
REMOVED & INSTALLED CHAFFER LOSS SENSOR

Disconnected wiring harness.
Removed cap screws and sensor.
Installed new sensor and connected harness.

REPLACED THE LEFT SHOE GRAIN LOSS SENSOR.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2780871**
Invoice Date: 2/13/2019
Location: 27
Work Order Number: 1289157
Payment Type: Finance
Tech: TERRY DEBOER
Page: 0 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

S660/1909/CL/10 Retail AXE55969	SENSOR	1.00	134.54	134.54	\$134.54	N
Labor: \$68.15		Parts: \$134.54	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$202.69	

S660/6403/A/25 Retail
COMPLAINT:
20 CHAINS & BELTS ALL - ADJUST

CORRECTION:
ADJUSTED ALL CHAINS & BELTS

Loosened jam nuts.
Adjusted all chains and belts.
Tightened jam nuts.



Labor: \$339.57	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$339.57
------------------------	----------------------	-------------------------	---------------------	----------------------------

S660/7702/53 Retail
COMPLAINT:
21 FUEL FILTER - CHANGE

CORRECTION:
CHANGED FUEL FILTER

Shut fuel tank off and removed and cleaned precleaner filter.
Reinstalled and turned fuel on.
Removed & replaced primary and secondary filters. (Filled with fuel prior to installing).
Bled fuel system and started.

JOHN DEERE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ112918	2 Micron Secondary Filter Element	1.00	117.17	117.17	\$117.17	N



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2780871**
Invoice Date: 2/13/2019
Location: 27
Work Order Number: 1289157
Payment Type: Finance

Tech: TERRY DEBOER Page 11 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

S660/7702/53 Retail RE539465	Filter Element - Primary	1.00	94.47	94.47	\$94.47	N
Labor: \$68.15		Parts: \$211.64	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$279.79	

S660/7703/PCG/53 Retail
COMPLAINT:
22 OIL PRIMARY COUNTER SHAFT GEAR CASE - CHANGE

CORRECTION:
CHANGED PRIMARY COUNTER SHAFT GEAR CASE OIL

Removed plug from primary countershaft gear case.
Drained oil and installed drain plug.
Removed dipstick and tube to help fill.
Filled to specification.
Installed dipstick tube and dipstick.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26408	HD460 Synthetic Gear Lube QT	2.00	21.81	21.81	\$43.62	Y
Labor: \$136.29		Parts: \$43.62	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$179.91	

S660/7704/CAB/53 Retail
COMPLAINT:
24 FILTER CAB ALL - CHANGE



CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2780871**
Invoice Date: 2/13/2019
Location: 27
Work Order Number: 1289157
Payment Type: Finance
Tech: TERRY DEBOER
Page: 2 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

S660/7704/CAB/53 Retail
CHANGED ALL CAB FILTERS

Opened the access door outside the cab.
Removed the filter cover.
Removed the cab air filter.
Removed the plastic grate from the filter housing and cleaned.
Installed the new cab filter.
Removed the container from behind the instructional seat to gain access to the recirculation filter.
Installed a new filter.

BLEW OUT ENGINE AIR FILTER.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
L214634	FILTER	1.00	18.40	18.40	\$18.40	N
RE284091	AIR FILTER can use PA5696	1.00	58.59	58.59	\$58.59	N
Labor: \$68.15		Parts: \$76.99		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$145.14

S660/9002/86 Retail
COMPLAINT:
25 LUBRICATE MACHINE

CORRECTION:
LUBRICATED MACHINE

Lubricated all grease points on the machine.

Labor: \$204.44	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$204.44
------------------------	----------------------	-------------------------	---------------------	----------------------------

Gen-26 Retail

COMPLAINT:
26 2 sets chopper knives, sieve frame seal and strap, grain tank drain cover, fh door washers, header belt bushing, sep door seal

CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		Invoice Number: 2780871	
Bus: 712-324-4088 Prv: (712)348-4308		Bus: (712)324-4088 Prv: (712)348-4308		Invoice Date: 2/13/2019	
Mob: (712)348-4308		Mob: (712)348-4308		Location: 27	
				Work Order Number: 1289157	
				Payment Type: Finance	
				Tech: TERRY DEBOER	Page: 3 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

Gen-26 Retail

REPLACED TWO SETS OF CHOPPER KNIVES.
 REPLACED THE SIEVE FRAME REAR SEAL AND STRAP.
 INSTALLED THE MISSING GRAIN TANK DRAIN COVER.
 INSTALLED WASHERS ON THE FEEDER HOUSE TRANSITION DOOR BOLTS.
 INSTALLED ONE SEPARATOR DOOR SEAL.
 REPLACED THE PRIMARY HEADER BELT TENSIONER BUSHING.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H129208	PIVOT	1.00	4.46	4.46	\$4.46	N
H208137	COVER	1.00	31.57	31.57	\$31.57	N
H226877	ISOLATOR	1.00	22.06	22.06	\$22.06	N
HXE29888	STRIP	1.00	39.38	39.38	\$39.38	N
HXE46741	SEAL	1.00	30.32	30.32	\$30.32	N
KXE10255	Knife Kit	2.00	172.01	172.01	\$344.02	N
M139714	RIVET	10.00	0.64	0.64	\$6.40	N
Labor: \$231.00		Parts: \$478.21		OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$709.21



S660/3105/RV/65 Retail

CORRECTION:
 REMOVED THE REVERSER GEARCASE FROM THE MACHINE.
 REMOVED THE RIGHT HAND DRIVESHAFT
 REMOVED THE VARIABLE SPEED SHEAVES.
 SPLIT THE REVERSER GEAR CASE AND DISASSEMBLED THE GEARCASE.
 REMOVED THE SHIFT FORK AND REPLACED THE SHIFT FORK SEAL.
 CLEANED THE TWO HOUSINGS UP AND ASSEMBLED THEM BACK TOGETHER WITH HIGH FLEX FORM IN PLACE
 GASKET MAKER.
 INSTALLED THE INPUT SHAFT COVER WITH A NEW SEAL AND GASKET MAKER ON THAT COVER.
 INSTALLED THE REVERSER BACK ON THE MACHINE.
 INSTALLED THE RIGHT HAND DRIVE SHAFT.
 INSTALLED THE VARIABLE SPEED SHEAVES AND SPRING.
 FILLED THE REVERSER WITH NEW OIL .
 RAN THE MACHINE AND RECHECKED THE OIL LEVEL.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH215259	SEAL	1.00	143.90	143.90	\$143.90	N



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **2780871**
Invoice Date: 2/13/2019
Location: 27
Work Order Number: 1289157
Payment Type: Finance

Tech: TERRY DEBOER Page: 4 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1500	1H0S660SKC0747286	Z5706WZ	

Part Description	QTY	UNIT PRICE	AMOUNT	TAX	AMOUNT	DISC	TOTAL	TYPE
S660/3105/RV/65 Retail								
DE30216 SEAL	1.00	11.01	11.01		\$11.01			N
H223849 RING	1.00	3.80	3.80		\$3.80			N
R41339 SHIM	1.00	2.37	2.37		\$2.37			N
TY26408 HD460 Synthetic Gear Lube QT	4.00	21.81	21.81		\$87.24			Y

Labor: \$544.01 Parts: \$248.32 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$792.33

INVOICE CONTAINS \$1.79 DISCOUNT

Miscellaneous Charges:
Service Accessories

\$49.30

Customer PO No:
Tax Exempt No: 2018/1
Advisor: KELLIE EINCK

Finance Information

Type: Multi-use Acct US Auth. No: 787306
 Merchant No: 36000775
 Card No: xxxxxxxxxxxx0940
 Bill Code: 705 - JD COMBINE PARTS/SERVICE
 Credit Plan: 11416 - DEERE AG NO PAYMENTS/NO INTEREST WAIVER UNTIL

Labor: \$4,492.86
 Parts: \$4,565.59
 OL&M: \$0.00
 Misc: (\$403.62)
 Sales Tax: \$327.10
 Grand Total: \$8,981.93

*** DOCUMENT COPY ***



TERMS AND CONDITIONS

Repayment Terms: Customer Disclosure - This form must be signed by the customer to process the Multi-Use Account transaction. The following special terms, as described in the Multi-Use Account credit agreement, apply to the attached invoice. No Payments and No Interest until October 1, 2019. Following the deferral period, the ANNUAL PERCENTAGE RATE (APR) applicable to your Account will apply to this purchase.

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3254745**
Invoice Date: 11/27/2020
Location: 27
Work Order Number: 1376160
Payment Type: Finance
Tech: Kendall Hofman
Page: 1 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

AVE/9002/PH1/590 Retail

CORRECTION:
COMPLETED COMBINE INSPECTION PHASE 1 \$399

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
P3790	PARTS PROMOTIONAL DISCOUNT	-1.00	327.02	327.02	(\$327.02)	N
P3794	SERVICE DISCOUNT ALLOWED	-1.00	513.36	513.36	(\$513.36)	N
Labor: \$399.00		Parts: \$0.00	OL&M: \$0.00	Misc: (\$840.38)	Sub-Total: (\$441.38)	

S660/6906/UF/10 Retail

COMPLAINT:
03 SHEET UPPER FLOOR - REMOVE & INSTALL
REMOVE & INSTALL UPPER FLOOR SHEET
Raise and lock feeder house.
Remove hardware attaching floor sheet.
Remove and install floor sheet.



CORRECTION:
REMOVED & INSTALLED UPPER FLOOR SHEET

Raised and locked feeder house
Removed hardware attaching floor sheet
Removed and installed floor sheet

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE24554	Floor	1.00	1,276.12	1,276.12	\$1,276.12	N
Labor: \$477.58		Parts: \$1,276.12	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,753.70	

S660/4164/UCC/10 Retail

COMPLAINT:

5671 460th St
 Paullina, IA 51046
 Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:


LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201 Bus: 712-324-4088 Prv: (712)348-4308 Mob:(712)348-4308		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201 Bus: (712)324-4088 Prv: (712)348-4308 Mob:(712)348-4308		Invoice Number: 3254745 Invoice Date: 11/27/2020 Location: 27 Work Order Number: 1376160 Payment Type: Finance Tech: Kendall Hofman	Page: 2 of 14
--	--	---	--	---	---------------

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

S660/4164/UCC/10 Retail
 04 SPROCKET UPPER CONVEYOR CHAIN DRIVE - REMOVE & INSTALL
 REMOVE & INSTALL UPPER CONVEYOR CHAIN DRIVE SPROCKET
 Remove necessary components in order to remove feeder house from machine.
 Separate chain, remove slip clutch and remove wear plates.
 Loosen sprockets and remove shaft from machine.
 Install new sprockets and hardware.
 Reinstall shaft and reassemble feeder house.
 Reinstall on machine.

CORRECTION:
 REMOVED & INSTALLED UPPER CONVEYOR CHAIN DRIVE SPROCKET

Removed necessary components in order to remove feeder house from machine
 Separated chain, removed slip clutch and removed wear plates
 Loosened sprockets and removed shaft from machine
 Installed new sprockets and hardware
 Reinstalled shaft and reassembled feeder house
 Reinstalled on machine

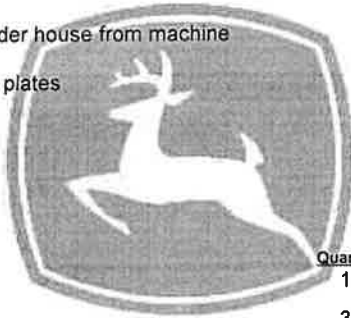

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7032	COTTER PIN	1.00	0.68	0.68	\$0.68	N
HXE123463	CHAIN SPRO	3.00	109.78	109.78	\$329.34	N
JD10020	Ball Bearing	1.00	41.40	41.40	\$41.40	N
JD9373	Ball Bearing	1.00	38.27	38.27	\$38.27	N
07485	ROLOC	2.00	3.24	3.24	\$6.48	Y
Labor: \$1,080.00		Parts: \$416.17		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$1,496.17

Gen-5 Retail
 COMPLAINT:
 05 UPPER CONVEYOR CHAIN STRIPS WORN

CORRECTION:
 Installed new upper plastic wear strips in feederhouse.



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3254745**
Invoice Date: 11/27/2020
Location: 27
Work Order Number: 1376160
Payment Type: Finance
Tech: Kendall Hofman
Page: 3 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

Gen-5 Retail

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H171960	STRIP	3.00	18.70	18.70	\$56.10	N
Labor: \$112.50		Parts: \$56.10		OL&M: \$0.00		Misc: \$0.00
Sub-Total: \$168.60						

S660/1357/DB/10 Retail

COMPLAINT:

06 BELT DISCHARGE BEATER - REMOVE & INSTALL
REMOVE & INSTALL DISCHARGER BEATER BELT
Loosen discharge beater belt adjuster.
Remove and replace discharge beater belt and readjust.
Test for proper operation.



CORRECTION:

Tested for proper operation.
Installed discharge beater drive sheave shield.
Installed both straw chopper drive belts.
Removed and replaced discharge beater belt and readjusted.
Removed & Installed discharger beater belt
Loosened discharge beater belt adjuster
Removed and replaced discharge beater belt and readjusted
Tested for proper operation

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE15556	V-BELT	1.00	106.00	106.00	\$106.00	N
Labor: \$180.00		Parts: \$106.00		OL&M: \$0.00		Misc: \$0.00
Sub-Total: \$286.00						

Gen-7 Retail

COMPLAINT:

07 FIX SEAL

CORRECTION:

Seal on left side of chaffer was coming loose. Cleaned debris out of seal groove and bent it tighter. Pushed seal back on.



WWW.AGRIVISIONEQUIPMENT.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201	LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201	Invoice Number: 3254745 Invoice Date: 11/27/2020 Location: 27 Work Order Number: 1376160 Payment Type: Finance
Bus: 712-324-4088 Prv: (712)348-4308 Mob:(712)348-4308	Bus: (712)324-4088 Prv: (712)348-4308 Mob:(712)348-4308	Tech: Kendall Hofman Page: 4 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

Gen-7 Retail

Labor: \$76.50	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$76.50
-----------------------	----------------------	-------------------------	---------------------	---------------------------

S660/1357/RCS/10 Retail

COMPLAINT:

08 BELT REAR COUNTER SHAFT - REMOVE & INSTALL
REMOVE & INSTALL REAR COUNTER SHAFT BELT

- Remove tailings auger drive belt.
- Remove slip clutch and sheave assembly.
- Remove clean grain drive belt.
- Remove jackshaft and support.
- Remove flanges and outside bearing.
- Remove flanges and inside bearing.
- Remove jackshaft.
- Remove rear counter shaft belt.
- Install belt.
- Reinstall all items in reverse order.
- Tighten all belt guides to specification.
- Run and verify operation.



CORRECTION:

REMOVED & INSTALLED REAR COUNTER SHAFT BELT

- Removed tailings auger drive belt
- Removed slip clutch and sheave assembly
- Removed clean grain drive belt
- Removed jackshaft and support
- Removed flanges and outside bearing
- Removed flanges and inside bearing
- Removed jackshaft
- Removed rear counter shaft belt
- Installed belt
- Reinstalled all items in reverse order
- Tightened all belt guides to specification

JOHN DEERE

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Inv</u>
--------------------	--------------------	-----------------	-------------------	------------------	-----------------------	------------------



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3254745**
Invoice Date: 11/27/2020
Location: 27
Work Order Number: 1376160
Payment Type: Finance
Tech: Kendall Hofman
Page: 5 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

S660/1357/RCS/10 Retail	H154723	V-BELT	1.00	86.82	86.82	\$86.82	N
Labor: \$207.00		Parts: \$86.82	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$293.82		

S660/1357/CGD/10 Retail
COMPLAINT:
09 BELT CLEAN GRAIN DRIVE - REMOVE & INSTALL
REMOVE & INSTALL CLEAN GRAIN DRIVE BELT
Open gull wing door.
Unbolt tensioner and release tension.
Remove belt and install new belt.
Retention to specification and test run.



CORRECTION:
Removed & Installed clean grain drive belt
Opened gull wing door
Unbolted tensioner and released tension
Removed belt and installed new belt
Retention to specification and test ran

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H218645	V-BELT	1.00	149.34	149.34	\$149.34	N
Labor: \$132.00		Parts: \$149.34	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$281.34	



S660/1508/RDV/10 Retail
COMPLAINT:
10 BELT RADIATOR DEBRIS VACUUM UPPER DRIVE - REMOVE & INSTALL
REMOVE & INSTALL RADIATOR DEBRIS VACUUM UPPER DRIVE BELT
Loosen and remove rotary screen jack shaft drive belt.
Loosen debris vacuum upper drive belt tensioner.
Remove debris vacuum drive belt.
Install in reverse order.
Adjust belts to spec.

CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3254745**
Invoice Date: 11/27/2020
Location: 27
Work Order Number: 1376160
Payment Type: Finance
Tech: Kendall Hofman
Page: 6 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

S660/1508/RDV/10 Retail
REMOVED & INSTALLED RADIATOR DEBRIS VACUUM UPPER DRIVE BELT

Loosened and removed rotary screen jack shaft drive belt
Loosened debris vacuum upper drive belt tensioner
Removed debris vacuum drive belt
Installed in reverse order
Adjusted belts to spec

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE68016	V-BELT	1.00	21.91	21.91	\$21.91	N
Labor: \$165.00		Parts: \$21.91		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$186.91



S660/1509/RDV/10 Retail
COMPLAINT:

11 BELT RADIATOR DEBRIS VACUUM LOWER DRIVE - REMOVE & INSTALL
REMOVE & INSTALL RADIATOR DEBRIS VACUUM LOWER DRIVE BELT
Loosen vacuum lower drive belt tensioner.
Remove belt.
Install in reverse order.
Adjust belt to spec.

CORRECTION:
REMOVED & INSTALLED RADIATOR DEBRIS VACUUM LOWER DRIVE BELT

Loosened vacuum lower drive belt tensioner
Removed belt
Installed in reverse order
Adjusted belt to spec



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE68015	V-BELT	1.00	23.52	23.52	\$23.52	N
Labor: \$37.50		Parts: \$23.52		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$61.02

Gen-12 Retail
COMPLAINT:

5671 460th St
 Paullina, IA 51046
 Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		Invoice Number: 3254745 Invoice Date: 11/27/2020 Location: 27 Work Order Number: 1376160 Payment Type: Finance	
Bus: 712-324-4088	Prv: (712)348-4308	Bus: (712)324-4088	Prv: (712)348-4308	Tech: Kendall Hofman	
Mob: (712)348-4308		Mob: (712)348-4308		Page: 7 of 14	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

Gen-12 Retail
 12 REPLACE ETHER TUBE

CORRECTION:
 Removed old ether tube. Installed new ether tube with new fittings. Wrapped tape around tube where it could rub.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE21790	ELBOW FITT	2.00	9.10	9.10	\$18.20	N
Labor: \$75.00		Parts: \$18.20		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$93.20

S660/6403/A/25 Retail
COMPLAINT:
 13 CHAINS & BELTS ALL - ADJUST
 ADJUST ALL CHAINS & BELTS
 Loosen jam nuts.
 Adjust all chains and belts.
 Tighten jam nuts.



CORRECTION:
 Adjusted all chains & belts
 Loosened jam nuts
 Adjusted all chains and belts
 Tightened jam nuts

Labor: \$441.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$441.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

S660/7702/53 Retail
COMPLAINT:
 14 FUEL FILTER - CHANGE
 CHANGE FUEL FILTER
 (Note: Includes water separator).
 Shut fuel tank off and remove and clean precleaner filter.
 Reinstall and turn fuel on.
 Remove & replace primary and secondary filters. (Fill with fuel prior to installing).
 Bleed fuel system and start.



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3254745**
Invoice Date: 11/27/2020
Location: 27
Work Order Number: 1376160
Payment Type: Finance
Tech: Kendall Hofman
Page: 8 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

S660/7702/53 Retail

CORRECTION:

Changed fuel filter
Shut fuel tank off and removed and cleaned precleaner filter
Reinstalled and turned fuel on
Removed & replaced primary and secondary filters
Filled with fuel prior to installing
Bled fuel system and started

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ112918	2 Micron Secondary Filter Element	1.00	110.31	110.31	\$110.31	N
RE539465	Filter Element - Primary	1.00	79.48	79.48	\$79.48	N
Labor: \$88.50		Parts: \$189.79		OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$278.29

S660/7704/HO/53 Retail

COMPLAINT:

15 FILTER HYDRAULIC OIL - CHANGE
CHANGE HYDRAULIC OIL FILTER
Remove and discard old hydraulic filters.
Fill new filters with oil.
Install filters on machine.

CORRECTION:

Changed hydraulic oil filter
Removed and discarded old hydraulic filters
Filled new filters with oil
Installed filters on machine
Added hydraulic oil to reservoir.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH128449	HYDRAULIC FILTER	1.00	54.95	54.95	\$54.95	N
TY26625	BULK HY-GARD GALLON	1.00	9.89	9.89	\$9.89	Y
Labor: \$58.50		Parts: \$64.84		OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$123.34



JOHN DEERE



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		Invoice Number: 3254745	
Bus: 712-324-4088 Prv: (712)348-4308		Bus: (712)324-4088 Prv: (712)348-4308		Invoice Date: 11/27/2020	
Mob: (712)348-4308		Mob: (712)348-4308		Location: 27	
				Work Order Number: 1376160	
				Payment Type: Finance	
				Tech: Kendall Hofman	Page: 9 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

S660/7704/EGC/53 Retail

COMPLAINT:

16 FILTER ENGINE GEAR CASE - CHANGE
CHANGE ENGINE GEAR CASE FILTER
Remove and replace filter.
Start and run machine.
Shut off and check oil level.
Fill to spec.

CORRECTION:

Changed engine gear case filter
Removed and replaced filter
Started and ran machine
Shut off and checked oil level
Filled to spec



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH128449	HYDRAULIC FILTER	1.00	54.95	54.95	\$54.95	N
Labor: \$43.50		Parts: \$54.95		OL&M: \$0.00		Misc: \$0.00
				Sub-Total: \$98.45		

S660/7704/HS/53 Retail

COMPLAINT:

17 FILTER HYDROSTAT - CHANGE
CHANGE HYDROSTAT FILTER
Remove and discard old hydrostat filter.
Fill new filters with oil.
Install filters on machine.



CORRECTION:

Changed hydrostat filter
Removed and discarded old hydrostat filter
Filled new filters with oil
Installed filters on machine

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3254745**
Invoice Date: 11/27/2020
Location: 27
Work Order Number: 1376160
Payment Type: Finance
Tech: Kendall Hofman
Page: 0 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

S660/7704/HS/53 Retail	HYDRAULIC FILTER	1.00	54.95	54.95	\$54.95	N
Labor: \$58.50		Parts: \$54.95	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$113.45	

S660/7703/PCG/53 Retail

COMPLAINT:
18 OIL PRIMARY COUNTER SHAFT GEAR CASE - CHANGE
CHANGE PRIMARY COUNTER SHAFT GEAR CASE OIL
Remove plug from primary countershaft gear case.
Drain oil and install drain plug.
Remove dipstick and tube to help fill.
Fill to specification.
Install dipstick tube and dipstick.



CORRECTION:
Changed primary counter shaft gear case oil
Removed plug from primary countershaft gear case
Drained oil and installed drain plug
Removed dipstick and tube to help fill
Filled to specification
Installed dipstick tube and dipstick

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26408	HD460 Synthetic Gear Lube QT	2.00	28.86	28.86	\$57.72	Y
Labor: \$177.00		Parts: \$57.72	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$234.72	

S660/7703/RGC/53 Retail

COMPLAINT:
19 OIL ROTOR GEAR CASE - CHANGE
CHANGE ROTOR GEAR CASE OIL
Open valve on rotor gear case and drain.
Close valve and fill to specification.

CORRECTION:

5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		Invoice Number: 3254745	
Bus: 712-324-4088 Prv: (712)348-4308		Bus: (712)324-4088 Prv: (712)348-4308		Invoice Date: 11/27/2020	
Mob:(712)348-4308		Mob:(712)348-4308		Location: 27	
				Work Order Number: 1376160	
				Payment Type: Finance	
				Tech: Kendall Hofman	
				Page 1 of 14	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

S660/7703/RGC/53 Retail
Changed rotor gear case oil
Opened valve on rotor gear case and drained
Closed valve and filled to specification

Labor: \$177.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$177.00
-----------------	---------------	--------------	--------------	---------------------

S660/7703/RV/53 Retail
COMPLAINT:
20 OIL REVERSER - CHANGE
CHANGE REVERSER OIL
Remove plug from reverser gear case.
Remove lines from cooler.
Drain cooler and lines.
Install all items removed and fill to specification.
Run and verify level.



CORRECTION:
Changed reverser oil
Removed plug from reverser gear case
Removed lines from cooler and drained cooler and lines
Installed all items removed and filled to specification
Ran and verified level

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26408	HD460 Synthetic Gear Lube QT	5.00	28.86	28.86	\$144.30	Y

Labor: \$165.00	Parts: \$144.30	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$309.30
-----------------	-----------------	--------------	--------------	---------------------

S660/9002/86 Retail
COMPLAINT:
21 MACHINE LUBRICATE
LUBRICATE MACHINE
Lubricate all grease points on the machine.

CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: 712-324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3254745**
Invoice Date: 11/27/2020
Location: 27
Work Order Number: 1376160
Payment Type: Finance
Tech: Kendall Hofman
Page: 2 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

S660/9002/86 Retail
Lubricated machine
Lubricated all grease points on the machine

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26350	CHAIN AND CABLE LUBRICANT	1.00	5.09	5.09	\$5.09	Y
TY6341	SD Polyurea Grease	4.00	4.64	4.64	\$18.56	Y
Labor: \$172.50		Parts: \$23.65		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$196.15

Gen-22 Retail
COMPLAINT:
22 GREASE ENGINE FAN DRIVE

CORRECTION:
Loosened hydraulic fan valve. Pushed lower sheave in all the way and allowed upper sheave to collapse all the way. Filled upper and lower sheaves with synthetic grease.



Labor: \$112.50	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$112.50
------------------------	----------------------	-------------------------	---------------------	----------------------------

Gen-23 Retail
COMPLAINT:
23 CHANGE OIL IN TRANSMISSION AND FINAL DRIVES

CORRECTION:
Drained oil from transmission and Final drives. Filled Transmission and final drives with new 80/90 oil.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26816	GL5 80W90 5 gal	2.00	119.48	119.48	\$238.96	Y
Labor: \$342.00		Parts: \$238.96		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$580.96

Gen-24 Retail
CORRECTION:
Plastic shield in upper clean grain elevator housing was worn. Installed new plastic shield and replaced worn bolts.



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201	LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201	Invoice Number: 3254745
Bus: 712-324-4088 Prv: (712)348-4308	Bus: (712)324-4088 Prv: (712)348-4308	Invoice Date: 11/27/2020
Mob:(712)348-4308	Mob:(712)348-4308	Location: 27
		Work Order Number: 1376160
		Payment Type: Finance
		Tech: Kendall Hofman
		Page: 3 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

Gen-24 Retail

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HDW8B	GRADE 8 SAE BULK HARDWARE/OZ	1.00	0.46	0.46	\$0.46	N
HXE18618	SHEET	1.00	73.28	73.28	\$73.28	N
Labor: \$90.00		Parts: \$73.74		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$163.74

S660/1357/SFA/10 Retail

CORRECTION:
REMOVED & INSTALLED SHOE FAN & CONVEYOR AUGER BELT

Removed belt
Installed belt



JOHN DEERE



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		Invoice Number: 3254745	
Bus: 712-324-4088 Prv: (712)348-4308		Bus: (712)324-4088 Prv: (712)348-4308		Invoice Date: 11/27/2020	
Mob:(712)348-4308		Mob:(712)348-4308		Location: 27	
				Work Order Number: 1376160	
				Payment Type: Finance	
				Tech: Kendall Hofman	Page: 4 of 14


Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	1962	1H0S660SKC0747286	Z5706WZ	

S660/1357/SFA/10 Retail HXE82335	V-BELT	1.00	213.09	213.09	\$213.09	N			
Labor: \$265.50		Parts: \$213.09		OL&M: \$0.00		Misc: \$0.00		Sub-Total: \$478.59	

Finance Information

Customer PO No:	Type: Multi-use Acct US	Auth. No: 739234	Labor:	\$5,133.58
Tax Exempt No: 2018/1	Merchant No: 36000775		Parts:	\$3,270.17
Advisor: TODD FULLER	Card No: xxxxxxxxxxxx0940		OL&M:	\$0.00
	Bill Code: 784 - COMBINE INSPECTION		Misc:	(\$840.38)
	Credit Plan: 11483 - DEERE AG 270 DAYS NO PAYMENTS/NO INTEREST		Sales Tax:	\$392.97
			Grand Total:	\$7,956.34

*** DOCUMENT COPY ***

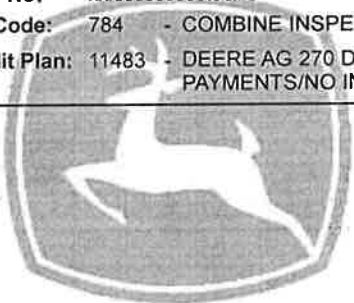

JOHN DEERE

TERMS AND CONDITIONS

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		Invoice Number: 3519704
Bus: (712)324-4088 Prv: (712)348-4308		Bus: (712)324-4088 Prv: (712)348-4308		Invoice Date: 12/6/2021
Mob:(712)348-4308		Mob:(712)348-4308		Location: 27
				Work Order Number: 1418246
				Payment Type: Finance
				Tech: ADAM HARPER
				Page: 1 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

AVE/9002/PH1/590 Retail

COMPLAINT:

**01 COMBINE INSPECTION PHASE 1 \$449

Combine Inspection \$449

5% off Parts and Service

2 Heads Inspected For Free

*Inspection price does not include oil analysis.

CORRECTION:

COMPLETED COMBINE INSPECTION PHASE 1 \$449

Labor: \$449.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$449.00
-----------------	---------------	--------------	--------------	---------------------

S660/6404/FHD/10 Retail

COMPLAINT:

**02 REMOVE & INSTALL FEEDER HOUSE DRIVE CHAIN

CORRECTION:

R&I feeder house drive chain

Removed shields

Separated and replaced drive chain

Replaced chain idlers as needed

Adjusted chain and reinstalled shields



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE80366	LINK CHAIN	1.00	132.46	132.46	\$132.46	N

Labor: \$87.03	Parts: \$132.46	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$219.49
----------------	-----------------	--------------	--------------	---------------------

S660/4159/RVD/10 Retail

COMPLAINT:

**03 REMOVE & INSTALL REVERSER DRIVE IDLER

CORRECTION:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201	LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201	Invoice Number: 3519704
Bus: (712)324-4088 Prv: (712)348-4308	Bus: (712)324-4088 Prv: (712)348-4308	Invoice Date: 12/6/2021
Mob:(712)348-4308	Mob:(712)348-4308	Location: 27
		Work Order Number: 1418246
		Payment Type: Finance
		Tech: ADAM HARPER
		Page: 2 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

S660/4159/RVD/10 Retail
R&I REVERSER DRIVE IDLER
 Loosened upper and lower reverser drive belts
 Removed idler pulley
 Installed in reverse order
 Adjusted upper and lower reverser drive belts to spec

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH204389	IDLER	1.00	84.01	84.01	\$84.01	N
Labor: \$129.80		Parts: \$84.01	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$213.81	

S660/4177/CVP/10 Retail
COMPLAINT:
****04 REMOVE & INSTALL CONVEYOR PLASTIC GUIDES**

CORRECTION:
 R&I conveyor plastic guides
 Removed top doors from feeder house
 Removed 3 bolts from plastic strips
 Installed new strips with new bolts



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H171960	STRIP	3.00	18.89	18.89	\$56.67	N
Labor: \$346.63		Parts: \$56.67	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$403.30	

S660/6914/9 Retail
COMPLAINT:
****05 LEVEL CONCAVE**

CORRECTION:
 Leveled concave
 Placed rotor gear case in neutral
 Removed rotor covers
 Leveled concave
 Calibrated



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		Invoice Number: 3519704	
Bus: (712)324-4088 Prv: (712)348-4308		Bus: (712)324-4088 Prv: (712)348-4308		Invoice Date: 12/6/2021	
Mob:(712)348-4308		Mob:(712)348-4308		Location: 27	
				Work Order Number: 1418246	
				Payment Type: Finance	
				Tech: ADAM HARPER	Page: 3 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

S660/6914/9 Retail

Labor: \$346.63	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$346.63
-----------------	---------------	--------------	--------------	---------------------

S660/4164/UAE/10 Retail

COMPLAINT:

**06 SPROCKET UNLOADING AUGER DRIVE EACH - Remove & Install.
 REMOVE & INSTALL EACH UNLOADING AUGER DRIVE SPROCKET
 Loosen unloading auger drive chain tensioner.
 Remove each required sprocket to replace.
 Reinstall and adjust drive chain
 Adjust to specs.

CORRECTION:

R&I unloading auger drive sprocket (each)
 Loosened unloading auger drive chain tensioner
 Removed each required sprocket to replace
 Reinstalled and adjusted drive chain
 Adjusted to specs



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
24M7254	WASHER	4.00	1.03	1.03	\$4.12	N
AXE21089	CHAIN SPRO	1.00	100.41	100.41	\$100.41	N
E64256	LOCK NUT	1.00	1.30	1.30	\$1.30	N
H218954	8MM X 55 8.8	1.00	2.08	2.08	\$2.08	N

Labor: \$87.03	Parts: \$107.91	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$194.94
----------------	-----------------	--------------	--------------	---------------------

S660/7558/ND/E/18 Retail

COMPLAINT:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3519704**
Invoice Date: 12/6/2021
Location: 27
Work Order Number: 1418246
Payment Type: Finance
Tech: ADAM HARPER
Page: 4 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

S660/7558/ND/E/18 Retail

****07 WEAR STRIP NEW STYLE DISCHARGE BEATER EACH - Rotate.**
ROTATE EACH NEW STYLE DISCHARGE BEATER WEAR STRIP
Raise chopper up and lower bottom plate.
Loosen and remove drive belt.
Remove bolts from strips and remove.
Rotate strips.
Install and put together in reverse order.

CORRECTION:

ROTATED EACH NEW STYLE DISCHARGE BEATER WEAR STRIP
Raised chopper up and lowered bottom plate
Loosened and removed drive belt
Removed bolts from strips and removed
Rotated strips
Installed and put together in reverse order



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7296	FLANGE NUT	4.00	1.30	1.30	\$5.20	N
Labor: \$261.08						
Parts: \$5.20						
OL&M: \$0.00						
Misc: \$0.00						
				Sub-Total:	\$266.28	

S660/1357/CPF/10 Retail

COMPLAINT:

****08 BELT CHOPPER FRONT - Remove & Install.**

REMOVE & INSTALL FRONT CHOPPER BELT
Remove shields.
Release tension on chopper belt.
Replace belt and check alignment.

CORRECTION:

R&I front chopper belt
Removed shields
Released tension on chopper belt
Replaced belt and checked alignment

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3519704**
Invoice Date: 12/6/2021
Location: 27
Work Order Number: 1418246
Payment Type: Finance
Tech: ADAM HARPER
Page: 5 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

S660/1357/CPF/10 Retail								
HXE124869	V-Belt	1.00	439.50	439.50	\$439.50	N		
Labor: \$207.98		Parts: \$439.50		OL&M: \$0.00		Misc: \$0.00		Sub-Total: \$647.48

S660/5183/CPI/10 Retail
COMPLAINT:
**09 PULLEY CHOPPER IDLER - Remove & Install.
REMOVE & INSTALL CHOPPER IDLER PULLEY
Raise chopper to loosen belt.
Remove drive belt shielding.
Remove and replace pulley as required.
Reverse and test for proper operation.



CORRECTION:
R&I chopper idler pulley
Raised chopper to loosen belt
Removed drive belt shielding
Removed and replaced pulley as required
Reversed and tested for proper operation

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>	
AH204389	IDLER	1.00	84.01	84.01	\$84.01	N	
Labor: \$87.03		Parts: \$84.01		OL&M: \$0.00		Misc: \$0.00	Sub-Total: \$171.04



S660/6062/CP/10 Retail
COMPLAINT:
**10 TAIL BOARD CHOPPER -Repair

CORRECTION:
R&I chopper tail board
Lowered chopper fully
Removed all tail board attaching hardware
Reinstalled in reverse and tested



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201	LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201	Invoice Number: 3519704
Bus: (712)324-4088 Prv: (712)348-4308	Bus: (712)324-4088 Prv: (712)348-4308	Invoice Date: 12/6/2021
Mob: (712)348-4308	Mob: (712)348-4308	Location: 27
		Work Order Number: 1418246
		Payment Type: Finance
		Tech: ADAM HARPER
		Page: 6 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

S660/6062/CP/10 Retail

Labor: \$129.80	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$129.80
-----------------	---------------	--------------	--------------	---------------------


S660/1357/FED/10 Retail

COMPLAINT:

**11 REMOVE & INSTALL FEED ACCELERATOR DRIVE BELT

CORRECTION:

R&I feed accelerator drive belt
 Released tension on accelerator belt, jackshaft belt and shoe supply auger belt
 Removed all belts from jackshaft
 Installed new accelerator belt
 Reset tension on jackshaft, accelerator and shoe auger belts
 Test ran

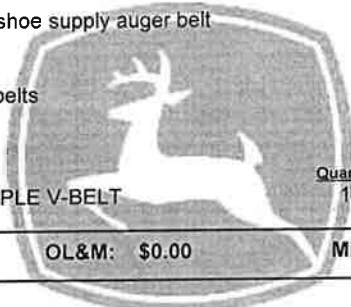

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
HXE95511	Feed Accelerator -TRIPPLE V-BELT	1.00	148.50	148.50	\$148.50	N

Labor: \$174.05	Parts: \$148.50	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$322.55
-----------------	-----------------	--------------	--------------	---------------------

S660/1357/FCS/10 Retail

COMPLAINT:

**12 REMOVE & INSTALL FRONT COUNTER SHAFT BELT

CORRECTION:

R&I front counter shaft belt
 Loosened spring assembly from idler to loosen belt
 Removed four upper bolts and two lower bolts that hold shield and support onto side of combine
 Removed belt from pulleys
 Installed in reverse order

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3519704**
Invoice Date: 12/6/2021
Location: 27
Work Order Number: 1418246
Payment Type: Finance
Tech: ADAM HARPER
Page: 7 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

S660/1357/FCS/10 Retail								
AH150678	BELT SET	1.00	130.38	130.38	\$130.38	N		
Labor: \$261.08		Parts: \$130.38		OL&M: \$0.00		Misc: \$0.00		Sub-Total: \$391.46

S660/6952/FCS/10 Retail
COMPLAINT:
**13 REMOVE & INSTALL FRONT COUNTER SHAFT TENSIONER

CORRECTION:
R&I front counter shaft tensioner
Loosened spring assembly from idler to loosen belt
Removed three bolts that held idler bracket to combine
Installed in reverse order



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind	
AH204389	IDLER	1.00	84.01	84.01	\$84.01	N	
Labor: \$87.03		Parts: \$84.01		OL&M: \$0.00		Misc: \$0.00	Sub-Total: \$171.04

S660/6404/TED/10 Retail
COMPLAINT:
**14 REMOVE & INSTALL TAILING ELEVATOR RETURN AUGER DRIVE CHAIN

CORRECTION:
R&I TAILING ELEVATOR RETURN AUGER DRIVE CHAIN
Loosened chain tensioner
Removed chain
Installed new chain
Tightened chain tensioner



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind	
AE23539	LINK CHAIN	1.00	39.75	39.75	\$39.75	N	
Labor: \$60.48		Parts: \$39.75		OL&M: \$0.00		Misc: \$0.00	Sub-Total: \$100.23



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3519704**
Invoice Date: 12/6/2021
Location: 27
Work Order Number: 1418246
Payment Type: Finance
Tech: ADAM HARPER
Page: 8 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

S660/6338/CGC/11 Retail

COMPLAINT:

**15 REMOVE CLEAN GRAIN CONVEYOR CHAIN HALF LINK

CORRECTION:

REMOVED CLEAN GRAIN CONVEYOR CHAIN HALF LINK

Removed half link from chain
Reconnected chain and adjusted to spec
Test ran machine

Labor: \$57.53	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$57.53
----------------	---------------	--------------	--------------	--------------------



S660/1370/RH/A/19 Retail

COMPLAINT:

**16 TIGHTEN RADIATOR HOSE CLAMPS

CORRECTION:

TIGHTENED RADIATOR HOSE CLAMPS
Tightened all radiator hose clamps on machine
Ran and verified operation

Labor: \$87.03	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$87.03
----------------	---------------	--------------	--------------	--------------------



S660/4059/LA/10 Retail

COMPLAINT:

**17 HOUSING LOADING AUGER - Remove & Install.

CORRECTION:

R&I LOADING AUGER HOUSING
Removed tube
Removed auger
Removed bearing
Removed bracket
Switched bearing holder and latches to new spout
Reinstalled tube and auger with new bearing
Test ran



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3519704**
Invoice Date: 12/6/2021
Location: 27
Work Order Number: 1418246
Payment Type: Finance

Tech: ADAM HARPER

Page: 9 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

S660/4059/LA/10 Retail

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7296	FLANGE NUT	10.00	1.30	1.30	\$13.00	N
19M7815	Screw	1.00	3.62	3.62	\$3.62	N
24M7180	WASHER	1.00	1.84	1.84	\$1.84	N
24M7296	WASHER	4.00	1.11	1.11	\$4.44	N
AH219094	TUBE	1.00	705.62	705.62	\$705.62	N
H137916	SHIM	1.00	4.75	4.75	\$4.75	N
H215755	DEFLECTOR	1.00	164.54	164.54	\$164.54	N
H229875	BOLT	4.00	2.30	2.30	\$9.20	N
HXE127153	Deflector	1.00	28.92	28.92	\$28.92	N
JD10384	Bearing	1.00	43.89	43.89	\$43.89	N
N15764	PRESSED FL	2.00	3.73	3.73	\$7.46	N
Labor: \$261.08	Parts: \$987.28	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,248.36		



S660/6927/LA/10 Retail

COMPLAINT:

**18 REMOVE & INSTALL LOADING AUGER

CORRECTION:

R&I LOADING AUGER

Removed lock pin, nuts, and shield

Removed spacer and bearing

Removed auger from housing

Installed new auger

Assembled in reverse order

JOHN DEERE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7589	LOCK NUT	1.00	3.06	3.06	\$3.06	N



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3519704**
Invoice Date: 12/6/2021
Location: 27
Work Order Number: 1418246
Payment Type: Finance
Tech: ADAM HARPER
Page: 0 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

S660/6927/LA/10 Retail	Auger	1.00	681.51	681.51	\$681.51	N			
Labor: \$156.35		Parts: \$684.57		OL&M: \$0.00		Misc: \$0.00		Sub-Total: \$840.92	

S660/7281/HUAP/65 Retail

COMPLAINT:
**19 RESEAL EACH HORIZONTAL UNLOADING AUGER INSPECTION DOOR

CORRECTION:
RESEALED EACH HORIZONTAL UNLOADING AUGER INSPECTION DOOR
Removed inspection door
Removed damaged seal and cleaned mating surface
Installed new seal
Installed door



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind			
H81330	ISOLATOR	2.00	13.89	13.89	\$27.78	N			
Labor: \$87.03		Parts: \$27.78		OL&M: \$0.00		Misc: \$0.00		Sub-Total: \$114.81	

S660/6927/HUAB/10 Retail

COMPLAINT:
**20 REMOVE & INSTALL HORIZONTAL UNLOADING AUGER (BOTH)

CORRECTION:
R&I both horizontal unloading auger augers
Removed boot from end of tube
Removed hanger and removed outer auger
Removed inner auger
Installed inner auger and time at 90 to vertical auger
Installed outer auger and time at 180 from inner
Installed boot

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7192	BOLT	4.00	0.95	0.95	\$3.80	N
14M7296	FLANGE NUT	9.00	1.30	1.30	\$11.70	N



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3519704**
Invoice Date: 12/6/2021
Location: 27
Work Order Number: 1418246
Payment Type: Finance

Tech: ADAM HARPER Page 1 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

S660/6927/HUAB/10 Retail

Part Number	Description	Qty	Unit Price	Total Price	Extended Price	Tax
19M7835	10x35 10.9 FLANGE BOLT	5.00	0.40	0.40	\$2.00	N
19M7866	8X20 10.9 FLANGE HEAD	1.00	1.13	1.13	\$1.13	N
24H1300	WASHER	7.00	4.78	4.78	\$33.46	N
24M7296	WASHER	4.00	1.11	1.11	\$4.44	N
AH203021	Auger	1.00	1,411.62	1,411.62	\$1,411.62	N
AH209150	BEARING WI	2.00	194.20	194.20	\$388.40	N
AXE56290	Auger	1.00	1,370.60	1,370.60	\$1,370.60	N
HDW10MB	BULK 10.9 METRIC HARDWARE/OZ	4.00	0.50	0.50	\$2.00	N
M84309	NUT	4.00	1.36	1.36	\$5.44	Y

Labor: \$346.63 Parts: \$3,234.59 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$3,581.22

S660/1437/A/80 Retail

COMPLAINT:

**21 CONTROLLER (All) - Check.
CHECK ALL CONTROLLERS FOR LATEST SOFTWARE
Check all electronic controllers on machine for codes and updated calibrations.

CORRECTION:

Checked all controllers for latest software
Checked all electronic controllers on machine for codes and updated calibrations

*had computer trouble during downloads. price discount noted in parts segment -\$147.50

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
P3794	SERVICE DISCOUNT ALLOWED	1.00	-1.00	-147.50	(\$147.50)	N

Labor: \$321.55 Parts: \$0.00 OL&M: \$0.00 Misc: (\$147.50) Sub-Total: \$174.05

S660/6403/A/25 Retail

COMPLAINT:

**22 CHAINS & BELTS ALL - Adjust.



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		LARRY VANMEETEREN 3367 LOG AVE SHELDON IA 51201		Invoice Number: 3519704
Bus: (712)324-4088 Prv: (712)348-4308		Bus: (712)324-4088 Prv: (712)348-4308		Invoice Date: 12/6/2021
Mob:(712)348-4308		Mob:(712)348-4308		Location: 27
				Work Order Number: 1418246
				Payment Type: Finance
				Tech: ADAM HARPER
				Page: 2 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

S660/6403/A/25 Retail

CORRECTION:

Adjusted all chains & belts
Loosened jam nuts
Adjusted all chains and belts
Tightened jam nuts
Also used this time to run and test machine and make sure everything was functioning properly
Also put all cover and shields back on the combine as well.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19	CHAIN LUBE	1.00	13.23	13.23	\$13.23	N
Labor: \$433.65		Parts: \$13.23		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$446.88

S660/9002/PMS/41 Retail

COMPLAINT:

**23 PERFORM MAINTENANCE COMBINE PARTIAL MACHINE SERVICE

CORRECTION:

Performed partial machine service
Changed oil in feeder house reverser gear case
Changed oil in primary counter shaft gear case
Changed oil in engine crank case
Changed engine oil filter
Changed all engine air filters
Changed all hydraulic filters
Changed all hydraulic oil
Changed engine gearcase filter
Changed fuel filters
Changed cab air filters
Greased entire machine



JOHN DEERE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH128449	HYDRAULIC FILTER	3.00	58.85	58.85	\$176.55	N
DZ112918	2 Micron Secondary Filter Element	1.00	99.73	99.73	\$99.73	N
HXE11090	Filter Element	1.00	186.36	186.36	\$186.36	N
HXE11091	Filter Element	1.00	135.45	135.45	\$135.45	N



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201


Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3519704**
Invoice Date: 12/6/2021
Location: 27
Work Order Number: 1418246
Payment Type: Finance
Tech: ADAM HARPER
Page: 3 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

S660/9002/PMS/41 Retail

RE284091	AIR FILTER can use PA5696	1.00	59.75	59.75	\$59.75	N
RE509672	Filter Element	1.00	21.39	21.39	\$21.39	N
RE539465	Filter Element - Primary	1.00	85.12	85.12	\$85.12	N
TY26101	CLEANING S	4.00	6.79	6.79	\$27.16	Y
TY26408	HD460 Synthetic Gear Lube QT	4.00	32.27	32.27	\$129.08	Y
TY26625	BULK HY-GARD GALLON	19.00	13.89	13.89	\$263.91	Y
TY26686	BULK PLUS-50 II/GALLON	10.00	16.49	16.49	\$164.90	Y
TY26816	GL5 80W90 5 gal	1.00	167.18	167.18	\$167.18	Y
TY27530	COOL-GARD PRE-MIX BULK	1.00	10.89	10.89	\$10.89	Y
TY6296	GL-5 SAE 80W90 QT	3.00	10.08	10.08	\$30.24	Y
TY6341	SD Polyurea Grease	2.00	5.23	5.23	\$10.46	Y
Labor: \$665.23		Parts: \$1,568.17	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,233.40	

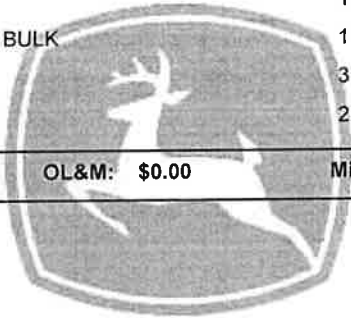

ALL/9002/WSD/91 Retail

COMPLAINT:
24 WASH & DETAIL CAB COMBINE
WASH EXTERIOR OF MACHINE.
CLEAN OUT CAB AND DETAIL.

CORRECTION:
WASHED & DETAILED CAB COMBINE



Labor: \$864.60	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$864.60
------------------------	----------------------	-------------------------	---------------------	----------------------------

Gen-25 Retail

COMPLAINT:
25 INSPECTION SPECIAL
5% OFF PARTS AND LABOR



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

SERVICE INVOICE

Invoice To Account No: 83482

Deliver To:

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201

Bus: (712)324-4088 Prv: (712)348-4308
Mob:(712)348-4308

Invoice Number: **3519704**
Invoice Date: 12/6/2021
Location: 27
Work Order Number: 1418246
Payment Type: Finance
Tech: ADAM HARPER
Page: 4 of 14

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S660	2194	1H0S660SKC0747286	Z5706WZ	

Gen-25 Retail
CORRECTION:
INSPECTION SPECIAL
5% OFF PARTS AND LABOR

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
P3790	PARTS PROMOTIONAL DISCOUNT	1.00	-1.00	-391.40	(\$391.40)	N
P3794	SERVICE DISCOUNT ALLOWED	1.00	-1.00	-226.71	(\$226.71)	N
Labor: \$0.00		Parts: \$0.00		OL&M: \$0.00		Misc: (\$618.11)
						Sub-Total: (\$618.11)

Customer PO No: Tax Exempt No: 2018/1 Advisor: TODD FULLER	Finance Information Type: Multi-use Acct US Auth. No: 163125 Merchant No: 36000775 Card No: xxxxxxxxxxxx0940 Bill Code: 784 - COMBINE INSPECTION Credit Plan: 12006 - DEERE AG NO PAYMENTS/NO INTEREST WAIVER UNTIL		Labor: \$5,995.33 Parts: \$7,828.02 OL&M: \$0.00 Misc: (\$765.61) Sales Tax: \$476.21
			Grand Total: \$13,533.95

*** DOCUMENT COPY ***



TERMS AND CONDITIONS

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date:



WWW.AGRIVISIONEQUIPMENT.COM



WWW.PRAIRIELANDPARTNERS.COM



5671 460th St
Paullina, IA 51046
Phone: (712) 448-3444

PARTS INVOICE

Invoice To Account No.: 83482

Deliver To Account No.: 83482

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201
US

LARRY VANMEETEREN
3367 LOG AVE
SHELDON IA 51201
US

Bus Ph: (712)324-4088 Prv Ph: (712)348-4308

Bus Ph: (712)324-4088 Prv Ph: (712)348-4308

Invoice No: 1000963812
Date: 11/16/2023
Page: 1 of 1
Payment Type: Check
Check No: 5469

Supplied Quantity	Back Order Quantity	Part Number	Part Description	Bin Loc	List Price	Net Price	Extended Price	Tax Ind
Eq ID: Z5706WZ 1.00	0.00	Make: JOHN DEERE DZ112918	Model: S660 2 Micron Secondary Filter Element	PIN: 1H0S660SKC0747286 F350	Hours: 2194 127.09	127.09	\$127.09	N

Customer PO No:
Tax Exempt No: 2018/1
Salesperson: WYATT RASSEL

Parts: \$127.09
Misc: \$0.00
Sales Tax: \$0.00
Deposit: \$0.00

Total: \$127.09



JOHN DEERE

TERMS AND CONDITIONS

Terms are Net 30. A Finance Charge of 2% per month which is an annual rate of 24% will be added to all past due invoices.

Returned goods must be accompanied with this invoice. No returns allowed on electrical components. A 15% handling fee will be charged unless due to defective goods or our error. Goods cut to length or special order goods are not returnable. NO RETURNS OR REFUNDS AFTER 30 DAYS. If not paid as agreed, this credit agreement provides for your payment of reasonable costs of collection, including, but not limited to, court costs, attorney fees and/or collection fees.

Received by: Date: